

Dear Sirs

We have recently received information about a potentially dangerous situation from the owner of an S70MC engine. During a routine overhaul of a piston, with an exchange of piston crown, the engine crew experienced that when loosening the bolts on the piston crown, the inner circular contact surface broke off.

In a situation where the contact face breaks off, the piston rod will either fall over or drop, depending on the circumstances. This poses a serious potential risk to property and persons and may even result in bodily injuries and/or fatal casualties.

In the procedure enclosed, we describe a method to check if a piston has a deviation in the bolted connection in the inner circular contact surface. The method involves the use of a reference screw before starting the lifting procedure. We recommend evaluating the condition of the piston crown contact surface at the first given opportunity.

If you find a deviation when following the procedure described in work card 8865-4204-0001, which is enclosed, the complete piston must be lifted as described in the same work card and the piston crown subsequently replaced.

If no deviations are found when using the reference screw, you can use the standard lifting procedure as described in the instruction book (work card 2265-0401 or M90201).

Please insert this service letter and work card 8865-4204-0001 in the instruction book. Insert the work card next to work card 2265-0401 or M90201.

Questions regarding this service letter should be directed to PrimeServ, at DT-CPH@mandieselturbo.com.

Yours faithfully

Wikael C Jensen

Vice President, Engineering

Head office (& postal address) MAN Diesel & Turbo Teglholmsgade 41 2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 30 info-cph@mandieselturbo.com www.mandieselturbo.com
 PrimeServ
 Produ

 Teglholmsgade 41
 Teglho

 2450 Copenhagen SV
 2450 C

 Denmark
 Denmark

 Phone:
 +45 33 85 11 00
 Phone

+45 33 85 10 49

PrimeServ-cph@mandieselturbo.com

Fax:

Stig B. Jakobsen

Production Teglholmsgade 35 2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 17 manufacturing-dk@mandieselturbo.com

Action code: AT FIRST OPPORTUNITY

Potential Crack in Piston Crown

- in inner circular contact flange

SL2016-626/SBJ September 2016

Concerns

Owners and operators of MAN B&W two-stroke marine diesel engines. Type: S70MC

Summary

To prevent personal injury and damage to the engine during piston overhaul (exchange of piston crown), we recommend evaluating the condition of the piston crown inner circular contact surface at the first given opportunity by following the procedure described in this service letter.



Forwarding & Receiving Teglholmsgade 35

2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 16 shipping-cph@mandieselturbo.com

MAN Diesel & Turbo

Branch of MAN Diesel & Turbo SE, Germany CVR No.: 31611792 Head office: Teglholmsgade 41 2450 Copenhagen SV, Denmark German Reg.No.: HRB 22056 Amtsgericht Augsburg

Checking

1.

4.

- Check that the engine is stopped and blocked according to the safety precautions given on the data sheet D10201 or 2265-0400.
- 2. Open the acces hatch to the scavenge air reciever and remove the acces cover of the scavenge air box for the relevant cylinder.



8865-4204-0001C01

- 3. Turn the piston of the relevant cylinder to BDC position.
 - Acces the underside of the piston from scavenge air box.

Remove the locking wire from one of the screws connecting the piston rod and the piston crown. Loosen and remove the screw from the piston



8865-4204-0001C04



8865-4204-0001

2016-07-04 - en

MAR



2 (8)

/ork Card

8.

If the screw shows signs of deformation or hard contact, as checked in step 5, OR if a gap is found between the reference screw and the piston rod flange, then the piston MUST be removed from the cylinder as described in the dismantling section of this Sinstruction.

Subsequently the piston crown MUST be scrapped.

9. If the screw shows no signs of deformation or hard contact, as checked in step 4, AND no gap is found between the reference screw and the piston rod flange, the piston can be removed from the engine and overhauled using the standard piston instruction M90201 or 2265-0401.

Dismantling

1.

Turn the relevant piston to TDC position.

Mount the piston lifting tool on the piston crown as described in the standard piston instruction M90201 or 2265-0401.

If a collar ring (piston lifting tool for low lifting height conditions) is available remove the piston from the engine as described in instruction M91309.





8865-4204-0001D01



Work Card 8865-4204-0001

2016-07-04 - en



3.

4.

5.

If a collar ring (piston lifting tool for low lifting height conditions) is not available remove the piston from the engine as described below : Lift up the piston until there is a gap of approx. 150 mm beween the underside of the piston skirt and the top of the cylinder liner. 150mm 8865-4204-0001D04 Mount one end of a wire rope around the upper end of the piston rod. Mount the other end of the wire rope as tight and securely as possible around the hook or the block of the engine room Â crane 8865-4204-0001D05 Lift away the piston from the engine as described in the standard piston instruction M90201 or 2265-0401. 8865-4204-0001D06

Special Piston Lifting

6.

8865-4204-0001

7.

Special Piston Lifting

Work Card 8865-4204-0001 The piston MUST be mounted in the support iron during dismantling of the piston crown and mounting of the new piston crown.

A CAUTION

A damaged piston crown (as described in the checking section of this S-instruction) can NOT be re-used or reconditioned.



2265-0401-0001C07



Special Running

1.

2.

The checking procedure MUST be carried out prior to special running of a cylinder unit.

If the screw shows signs of deformation or hard contact OR if a gap is found between the reference screw and the piston rod flange, as described in steps 4 and 6 of the checking section of this S-instruction, then special running with that cylinder cut out of action and the exhaust valve in fixed open position is NOT allowed.



Special running may NOT be carried out until the piston crown of that cylinder has been replaced.

