

UE SERVICE INFORMATION

Confidential

JAPAN ENGINE CORPORATION

SERVICE ENGINEERING DEPARTMENT, SERVICE ENGINEERING SECTION 1, MINAMIFUTAMI, FUTAMI-CHO, AKASHI-CITY 674-0093, JAPAN

TEL. +81-78-949-0804 (direct), e-mail: sales2@j-eng.co.jp (parts & engineer order), service@j-eng.co.jp (technical inquiry)

(1/2)

Subject :	Application	UEC Diesel Engine
Precaution of assembling piston rod stuffing box rings	Туре	All UEC
	No.	USI-13302E Rev.1
	If necessary	

We are sometimes reported that stuffing box drain was increased after replacement of stuffing box rings.

We consider that it is one of the considerable reasons that stuffing box ring was assembled upside down. So, please check the direction of stuffing box rings at your maintenance time.

One stage of Stuffing box ring is a set of upper ring and lower ring. Upper ring has set pin hole, Lower ring has set pin.

And also, please check the stamp marks of stuffing box rings at the same time.

CAUTION



Stamping mark does not indicate ring direction of top or bottom. Upper ring and power ring can be identified by pin hole or pin, respectively.

The response level shown in the upper right is Japan Engine Corporation's guidance and does not determine the response of users. Further, it is not guaranteed the every action carried out according to this service information.

The service information issued by Japan Engine Corporation included not only copyright but also all rights is reverted on Japan Engine Corporation.

corc	Newly issued. 15th Nov. 2019(T.Y, T.N, D.Y) No.0300 (31st Jan. 2014)	Approved	K.Yoshída	SERVICE ENGINEERING DEPARTMENT
	Rev.1 17 th Dec. 2020	Checked	H.Hirabayashi	SERVICE ENGINEERING SECTION
		Designed	D.Yasuda	DATE OF REVISED : 17th Dec. 2020



