

VESSEL : \_\_\_\_\_ DATE : [Click or tap to enter a date.](#)

AREA / LOCATION : **FFA – POOR PRACTICES RESULTING IN PSC DEFICIENCIES/ DETENTION**



Fire detector covered with plastic tape



Smoke detector covered with plastic bag



Hold back hook - Unacceptable



Worn out and wasted fire door frame



Deteriorated insulation



Fire damper flap wasted



Nozzle missing



Leaking fire hoses



Length of fire hose in Engine room more than 15 M



Corroded hydrant and missing coupling



Leaking fire line



Defective fire detector



Improper test method



Partly missing Class A insulation



Hole in A-60 class Bulk head



Fire extinguisher not charged



Fire damper wastage found after removing cover



Fire hose end secured using unapproved method

