

PSC campaign – Increase in Port State Control Detentions Experienced By Singapore Ships In Early 2019

Deficiency Group		Deficiency Code		Deficiency	Checked and found in good order
02	Structural Conditions	02101	Closing devices/watertight doors	Bosun's compartment door on cargo deck not watertight (deficient structural condition).	
02		02106	Hull damage impairing seaworthiness	Ballast tank No.1 port side frames cracked.	
02		02108	Electrical installations in general	At the time of the inspection, the electrical supply to elements necessary for propulsion, steering and safety of the vessel cannot be maintained or immediately restored in case of the loss of one generator. Generators in standby don't start immediately when on-load generator is stopped, and emergency generator starts first and take the load in about 40 seconds.	
02		02111	Beams, frames, floors-corrosion	Numerous structural members on deck are corroded and in some places wasted, mainly longitudinal (e.g. tank top stiffeners and beams).	
03	Water/Weathertight conditions	03108	Ventilators, air pipes, casings	Several vent heads from ballast tanks are not properly maintained (e.g. rubbers missing, float misplaced).	
03		03108	Ventilators, air pipes, casings	Found on the PS main deck at least 8 air pipes the gaskets not in place, also on SB side several air pipes the gasket not being in place.	
05	Radio Communications	05105	MF/HF Radio installation	MF Antenna broken (one third of the antenna missing at the top).	
07	Fire safety	07109	Fixed fire extinguishing installation	In CO2 room, several pilot lines are not as required: the pilot lines are bended and 1 hose was disconnected.	
07		07115	Fire-dampers	Engine room fire damper P/S defective.	
07		07117	Jacketed high pressure lines and oil leakage alarm	Jacketed piping system for high pressure fuel lines of G/E malfunction.	
08	Alarms	08107	Machinery controls alarm	The high level water alarm at the stern shaft malfunction.	
11	Life saving appliances	11104	Rescue boats	Rescue boat engine unable to start.	
11		11104	Rescue boats	Mechanical power to rescue boat crane defective.	

PSC campaign – Increase in Port State Control Detentions Experienced By Singapore Ships In Early 2019

11		11124	Embarkation arrangement survival craft	The iron hoop of the embarkation arrangements for survival craft on port side for connecting with the hull seriously corrosive - almost breakage.	
12	Dangerous goods	12106	Instrumentation	Several sampling pipes from the gas detection system on deck are not supported (brackets and supports are wasted due to corrosion).	
14	Pollution prevention	14104	Oil filtering equipment	Oily water separator defective.	
14		14402	Sewage treatment plant	Sewage treatment plant defective.	
14		14402	Sewage treatment plant	Sewage treatment plant defective.	
14		14402	Sewage treatment plant	Sewage (black water) discharging directly to over board during alongside at jetty VII port of Teluk Bayur.	
14		14402	Sewage treatment plant	The cylinder cover of sewage treatment plant - water leaking.	
14		14608	Incinerator incl. operations and operating manual	Incinerator defective.	
15	ISM	15102	Company responsibility and authority	SMS, as implemented, fails to ensure: 1)The crew are adequately rested as per deficiency number 7. 2)Reports of non-conformities are reported to the company. 3) Serious rest violations were evident prior to the annual audit (March 2018) and not identified.	
15		15111	Company verification, review and evaluation	Deficiency(s) marked ISM is(are) objective evidence of a serious failure, or lack of effectiveness, of implementation of the ISM Code.	
16	ISPS	16101	Security related defects	Security related defects	

Master:

CEO:

Date completed: