
YE SERVICE NEWS

Subject	Intaka/Evhalist Valva Stam Saal Insartion Lool - I		No. :YEN-CM-21853 Date :10th NOV 2016
Engine Model	See text below	Use	-
		Engine No.	-

The stem seal installed to the intake/exhaust valve guide, unless installed to the correct position, cannot display its performance, (prevention of gas seal and stem corrosion and sticking). This will cause abnormal wear of valve seat and increased lube oil consumption.

We prepare the specialized stem seal insertion tool for use with each engine model. Be sure to use the tool specified for each model whenever replacing the stem seal. For use, hold the tool straight and knock it by the middle. If not, the stem seal can be installed diagonally.

No.	Engine Model	Part No.		
1	6NY16、6N165、6NB165、6RY17、S165 6・8・12・16NHL	133614-92050		
2	6EY17	140695-92050		
	6N18、6·8N21、M200、S185、6EY18	146674-92050		
4	6EY22	150633-92050		
⑤	M220	147644-92060		
6	T220、T240	150623-92050		
7	T260	151623-92340		
8	T260(w/valve box)	151623-92330		
9	6N260	151605-92160		
10	6·8EY26	151695-93200		
11)	6·8N280、Z280、8Z280	153605-92330		
12	6·8N330(w/Roth mat)	132654-92170		
13	6N330 excepting GW,GV (before E/#0362)	132654-92160		
14)	6N330 GW、 GV (after E/#0379)	132859-92160		
15)	8N330 GW (excepted) GV (before E/#0166)	132654-92160		
16	8N330 GW、 GV (after E/#0171)	132859-92160		
1	6·8EY33	132673-92120		

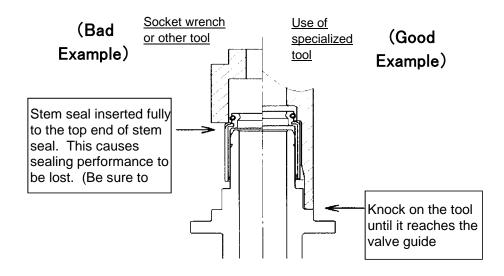

	Approved	Checked	Prepared	l
YANMAR ENGINEERING CO.,LTD Market Service Division	Y.tai	N.fujii	Y.miura	